CITY OF SACRAMENTO 1231 I Street, Sacramento, CA 95814

Permit No: 0101401

2 Insp Area:

Sub-Type: RES Housing (Y/N): N

ARCHITECT

Site Address: 7025 TAMOSHANTER WY SAC

Parcel No:

RSVL CA

035-0274-007

CONTRACTOR MITCHELL HALL TERMITE 820 ATLANTA ST

OWNER SHELTON THERESA A 7025 TAMOSHANTER WY SACRAMENTO CA 95822

of Work: DRY ROT REPAIRS TROUGHOUT HOUSE PER TERMITE REPORT

CONSTRUCTION LENDING AGI	I (Sec. 3097, Civ. C).		
Lender's Name	Lend	er'sAddress	
LICENSED CONTRACTORS DE commencing with section 7000) of Divis	CLARATION: I hereby affirm und	er penalty of perjury that I am 1	icensed under provisions of Chapter 9
License Class License Number	Date	Contractor Signature	
OWNER-BUILDER DECLARAT following reason (Sec. 7031.5, Business any structure, prior to its issuance, also re of the Contractors License Law (Chapte exempt therefrom and the basis for the alpenalty of not more than five hundred do	ION: I hereby affirm under penalty and Professions Code; any city or count equires the applicant for such permit to be r 9 (commencing with Section 7000) of leged exemption. Any violation of Sec	of perjury that I am exempt from y which requires a permit to consille a signed statement that he or see Division 8 of the Business and	n the contractors License Law for the truct, alter, improve, demolish, or repair he is licensed pursuant to the provisions Professions Code) or that he or she is
I, as a owner of the property, or more sale (Sec. 7044, Business and Profesthereon, and who does such work himsesale. If, however, the building or impropose of significant build or improve for the purpose of significant sale.	f or herself or through his/her own empty vement is sold within one year of comp	slaves provided that such impro	vements are not intended or offered for
Code: The Contractors License Law doceontractor(s) licensed pursuant to the Contractor	es not apply to an owner of property wi	ontractors to construct the projection builds or improves thereon, and	t (Sec. 7044, Business and Professions I who contracts for such projects with a
I am exempt under Sec	B & PC for this reason:		2 20/14
DateS	Owner Signature)	ing hard p	of Jenesa Spellow
IN ISSUING THIS BUILDING PERM all measurements and locations shown o or private agreement relating to permissi any improvement or the violation of any	IIT, the applicant represents, and the content of the application or accompanying drawble or prohibited locations for such important agreement relating to location or	ty relies on the representation of yings and that the improvement to rovements. This building permit of f improvements.	the applicant, that the applicant verified be constructed does not violate any law does not authorize any illegal location o
I certify that I have read this application relating to building construction and her			
Date //3//C	Applicant/Agent Signature	Carry Drock	Spor person
WORKER'S COMPENSATION I I have and will maintain a certific performance of work for which the perm	DECLARATION: I hereby affirm unate of consent to self-insure for workers it is issued	der penalty of perjury one of the f 'compensation as provided for by	ollowing declarations: Section 3700 of the Labor Code, forth
I have and will maintain worker which this permit is issued. My workers	compensation insurance carrier and po	ncy dumber are.	de, for the performance of the work fo
Carrier STATE FUND	Policy Nu	nmber 229-01 UNIT 0021946	Exp Date 01/01/2002
(This section need not be complex shall not employ any person in any ma subject to the workers' compensation pro	ted if the permit is for \$100 or less) I compared up to become problem to the And	ertify that in the performance of the second control of the second	he work for which this permit is issued. fornia and agree that if I should become those provisions.
	Applicant Signature 7	way Brooks	gor, spellor
	WORKERS COMBUNEATION COV	ERAGÉ IS EINLAWFUL AND S	HALL SUBJECT AN EMPLOYER T

WARNING: FAILURE TO SECURE WORKER'S COMPENSATION COVERAGE IS UNLAWFUL CRIMINAL PENALTIES AND CIVIL FINES UP TO ONE HUNDRED THOUSAND DOLLARS (\$100,000) IN ADDITION TO THE COST OF COMPENSATION, DAMAGES AS PROVIDED FOR IN SECTION 3706 OF THE LABOR CODE, INTEREST AND ATTORNEY'S FEE.



To: Steve B Fax: (916) 264-5897		e B	From:	Theresa A. Shelton	п
) 264-5897	Pages:	1	
Phone	Ľ		Date:	1/31/01	
Re:	Build	ling Permit	CC:		
× Urge	ont	☐ For Review	🗋 Please Comment	☐ Please Reply	□ Please Recycle
	n ron reci	Shelton give I arry Way, Sacramento, my work number (9	Prooks permission to get to CA 95822. If you have ad 916) 278-6101.	ouilding permits on n ditional questions or	ny home at 7025 concerns, please
Thanks		ur attention to this n	natter. Hylfo		
` /			/		

OWNER-BUILDER VERIFICATION

ATTENTION PROPERTY OWNERS

An owner-builder building permit has been applied for in your name and bearing your signature.

Please complete and return this information in the envelope provided at your earliest opportunity to avoid unnecessary delay in processing and issuing your building permit. No building permit will be issued until this verification is received.

1.	I personally plan to provide the major labor and materials for construction of the proposed Improvement (yes or no)
2.	I (have/have not) signed an application for A building permit for the proposed work.
3.	I have contracted with the following person (firm) to provide the proposed construction:
	Name MITCHELL HALL Address & 20 Atlantic St Rosrulle
	City Rose Ville Telephone 782-2303
	Contractors License No. OPR 8878
	I plan to provide portions of the work, but I have hired the following person to coordinate,
	Name Address
	CityTelephone
	Contractors License No
5.	I will provide some of the work but I have contracted (hired) the following to provide the Work indicated:
	Name Address Phone Type of work
	· · · · · · · · · · · · · · · · · · ·
Si	gned Jarry Brook for heresa Shellor
	b Address 7025 THMOSHANTER WY
Pe	ermit No: () () () ()

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

This is an inspection report only -- not a Notice of Completion

		ADDRESS OF PRO	PERTY INSPECTED			and the state of the state of		
BUILDING NO.	STREET	Ċ	TY	21P	COOPTY	INSPECTION	HUMBER C	JF
7025	TAMOSHANTER WAY	2	SACRAMENTO	95822	34	01/10/01	6	

MITCHELL HALL TERMITE CONTROL


820 Atlantic Street Roseville, CA 95678 (916) 782-2303 (916) 772-8483 FAX



Affix stamp here on Board copy only A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. ANY QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER.

REGISTRATION #	PR	2158	REPORT #	9948	06	STAMP #			ESCROW #		
ORDERED BY:		THERESA :	SHELLTON	7025	TAMOSHAN	IU WAY	SACRAMENIO	Ca	95822	·	
OKDERED BIT		422-0398	278-610)1	TINA COCK TANK	TET TITALE	CACTONMENTIO	<u></u>	95822		
REPORT SENT TO:		1422-0398			TANCSHAN	IO WAI	SACRAMENIO	UZ_	73022		
PROPERTY OWNER:		THERESA	SHELITON	7025	TAMOSHAN	IU WAY	SACRAMENTO	Ca	95822		
PROPERTY OWNERS		422-0398	278-610)1							

RIGINAL REPORT [X] LIMIT	ED REPORT SUPPLEMENTAL	REPORT - REINSPECTION REP	ORT	<u> </u>	St	amp	#				Dat			
RESIDENCE FURNISHE				Z 0+ -200 A01-A0	20-40888- 38143C	884-3184 2>82>318468		-103 480 30 BC02C 3	G-155 000 € 15140	© 4∑₽\$000 ⊢₽€∑-⊦₽8	MARTI - 3000 002H40H		A COTOTA	EXCESS->E 20-STURE
A CUROTRUCTURE AREA	SEE BELOW	See 1A-1C	-	-		-5-	_							
1. SUBSTRUCTURE AREA 2. STALL SHOWER	SEE BELOW	See 2A-2C												
3, FOUNDATIONS												_	_	_
4. PORCHES STEPS	CONCRETE		_ _	_	_						_	_	_	_
5. VENTILATION	SEE BELOW	See 5A			_	<u> </u>		_			_	_	_	
6. ABUTMENTS	NONE			<u> </u>	_	<u> </u>	_	<u> </u>	_			_	-	_
7. ATTIC SPACES	NOT INSPECTED		_	↓_	<u> </u>	<u> </u>	_		<u> </u>	_		_		-
8. GARAGES	SEE BELOW	See 8A-8E	_ _	4	ļ	ļ		_	<u> </u>	_				
8. DECKS PATIOS	SEE BELOW	See 9A,9B	_ _	ļ	_	<u> </u>	ļ	-	 				_	
10. OTHER INTERIOR	SEE BELOW	See10A-10D			-	ļ	<u> </u>	 	ļ	 				
11. OTHER EXTERIOR	SEE BELOW	See11A-11D	l	.1	L.,	<u> </u>	<u>l</u>	<u> </u>	Ĺ	<u>l:</u> _	l			

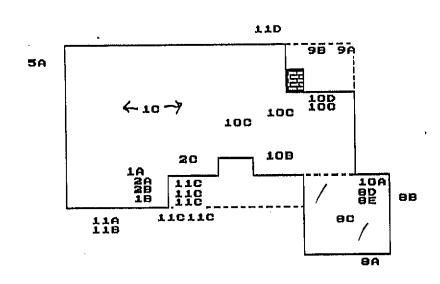

Inspected by KRISTOPHER KINSMAN

License No. FR25771

Signature

estions or problems with

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unsectived questions or problems services performed may be directed to the Structural Past Control Board at (916) 263-2533, or (800) 737-8188.

You are entitled to obtain copies of all reports and completion notices on this property filled with the Board during the preceeding two years upon payment of a \$2.00 search fee to: The Structural Past Control Board, 1418 Howe Ave., Ste. 18, Secremento, California 95825-3280.

۶,

7025	TAMOSHANTER WAY	SACRAMENTO	
BLDG. NO.	STREET	CITY	
	01/10/2001	994806	
STAMP NO.	DATE OF INSPECTION	CO. REPORT NO.	

A WOOD-DESTROYING PEST AND ORGANISM INSPECTION REPORT CONTAINS FINDINGS AS TO THE PRESENCE OR ABSENCE OF WOOD-DESTROYING PESTS AND ORGANISMS IN VISIBLE AND ACCESSIBLE AREAS AND CONTAINS RECOMMENDATIONS FOR CORRECTING ANY INFESTATIONS OR INFECTIONS FOUND. THE CONTENTS OF WOOD-DESTROYING PEST AND ORGANISM INSPECTION REPORTS ARE GOVERNED BY THE STRUCTURAL PEST CONTROL ACT AND REGULATIONS. SOME STRUCTURES DO NOT COMPLY WITH BUILDING CODE REQUIREMENTS OR MAY HAVE STRUCTURAL PLUMBING, ELECTRICAL, HEATING, AIR CONDITIONING OR OTHER DEFECTS THAT DO NOT PERTAIN TO WOOD-DESTROYING ORGANISMS. A WOOD-DESTROYING PEST AND ORGANISM INSPECTION REPORT DOES NOT CONTAIN INFORMATION ON SUCH DEFECTS, IF ANY, AS THEY ARE NOT WITHIN THE SCOPE OF THE LICENSES OF EITHER THE INSPECTOR OR THE COMPANY ISSUING THE REPORT.

AREAS NOT INSPECTED - SPECIAL NOTE TO ALL PARTIES REGARDING THIS PROPERTY

THE FOLLOWING AREAS WERE NOT INSPECTED, AS INDICATED IN SECTION #1990, PARAGRAPH (J) OF THE STRUCTURAL PEST CONTROL ACT AND RULES AND REGULATIONS: FURNISHED INTERIORS, INACCESSIBLE ATTICS, INSULATED ATTICS, AND PORTIONS THEREOF; THE INTERIOR OF HOLLOW WALLS: SPACES BETWEEN A FLOOR OR PORCH DECK AND THE CEILING OR SOFFIT BELOW: STALL SHOWERS OVER FINISHED CEILINGS: SUCH STRUCTURAL SEGMENTS AS PORTE COCHERES, ENCLOSED BAY WINDOWS, BUTTRESSES AND SIMILAR AREAS TO WHICH THERE IS NO ACCESS WITHOUT DEFACING OR TEARING OUT LUMBER, MASONRY AND FINISHED WORK, BUILT-IN CABINET WORK: FLOOR BENEATH COVERINGS, AREAS WHERE STORAGE CONDITIONS OR LOCKS MAKES INSPECTION IMPRACTICAL.

THE EXTERIOR SURFACE OF THE ROOF WILL NOT BE INSPECTED. IF YOU WANT THE WATER TICHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTOR'S STATE LICENSE BOARD.

MITCHELL HALL TERMITE CONTROL DOES NOT INCLUDE PAINTING AS PART OF THE REPAIR COSTS. IT IS THE OWNERS RESPONSIBILITY TO APPLY PAINT OR TO CONTRACT WITH OTHERS TO DO SO.

"NOTE: THE STRUCTURAL PEST CONTROL BOARDS ENCOURAGES COMPETITIVE BUSINESS PRACTICES AMOUNG REGISTERED COMPANIES. REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. termite infestations, termite damage, fungus damage, etc.) HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. THEREFORE, YOU MAY WISH TO SEEK A SECOND OPINION SINCE THERE MAY BE ALTERNATIVE METHODS OF CORRECTING THE FINDINGS LISTED ON THIS REPORT THAT MAY BE LESS COSTLY."

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION 1 AND SECTION 2 CONDITIONS EVIDENT ON THE DATE OF INSPECTION.

SECTION 1 - ITEMS CONTAIN ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION FOUND ON THE DATE OF INSPECTION.

SECTION 2 - ITEMS LISTED CONTAIN CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION, BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND ON THE DATE OF INSPECTION.

FURTHER INSPECTION - SPECIAL NOTE TO ALL PARTIES REGARDING THIS PROPERTY

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREAS WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CAN NOT BE DEFINED AS SECTION 1 AND SECTION 2.

7025	TAMOSHANTER WAY	SACRAMENTO
BLDG, NO.	STREET	CITY
	01/10/2001	994806
STAMP NO.	DATE OF INSPECTION	CO. REPORT NO.

SUBSTRUCTURE:

Item 1A: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE SUBFLOOR AND FRAMING
UNDER THE MASTER STALL SHOWER. IN ORDER TO MAKE REPAIRS THE STALL SHOWER
WILL BE REMOVED. OUR BID IS FOR MASTIC TILE OF A NEUTRAL COLOR.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

Item 1B: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE SUBFLOOR AND FRAMING: UNDER THE MASTER BATH.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

Item 1C: FINDING: CELLULOSE DEBRIS WAS FOUND ON THE SURFACE OF THE SOIL BENEATH THE STRUCTURE. THIS CONDITION IS CONDUCTVE TO SUBTERRANEAN TERMITE INFESTATION.

RECOMMENDATION: REMOVE ALL CELLULOSE DEBRIS OF A RAKEABLE SIZE OR LARGER FROM THE SUBSTRUCTURE AREA.

***** This is a Section 2 Item *****

STALL SHOWER:

Item 2A: FINDING: THE TOILET IS LOOSE IN THE MASTER BATH.

RECOMMENDATION: REMOVE THE TOILET AND INSTALL A NEW WAX FLANGE GASKET.
REINSTALL THE EXISTING TOILET.
***** This is a Section 1 Item *****

Item 2B: FINDING: THE UNDERLAYMENT IS SWOLLEN BENEATH THE LINOLEUM AT THE MASTER BATH.

WOOD DECAY FUNGI DAMAGE WAS PRESENT IN THE UNDERLAYMENT ON THE DAY OF
INSPECTION.

RECOMMENDATION: REMOVE THE DAMAGED PORTIONS OF LINOLEUM, UNDERLAYMENT AND TOILET. INSTALL NEW UNDERLAYMENT AND LINOLEUM. RESET TOILET ON A NEW WAX SEAL. OUR BID IS BASED ON THE INSTALLATION OF LINOLEUM THAT HAS NEUTRAL COLOR AND PATTERN AND FLAT LAID ONLY. SPECIFIC COLORS AND/OR PATTERNS WILL BE INSTALLED AT AN ADDITIONAL CHARGE.

***** This is a Section 1 Item *****

Item 2C: FINDING: THE GROUT IS DEFICIENT AT HALL BATH TUB AND FLOOR.

RECOMMENDATION: APPLY GROUT AS NEEDED TO FORM A WATER RESISTANT SEAL.

GROUT IS CONSIDERED A HOMEOWNER'S MAINTAINANCE RESPONSIBILITY.

*******This is a Section 2 Item ******

VENTILATION:

Item 5A: FINDING: VENT SCREENS WERE FOUND MISSING AND/OR DAMAGED AROUND STRUCTURE.
THIS WOULD ALLOW FOR RODENTS AND SMALL ANIMALS TO ENTER THE SUBSTRUCTURE
AREA.

RECOMMENDATION: REPLACE MISSING AND/OR DAMAGED VENT SCREENS WITH NEW VENT SCREENS.

***** This is a Section 2 Item *****

GARAGÉ:

Item 8A: FINDING: WOOD DECAY FUNGI DAMAGE WAS FOUND IN THE BASE OF THE GARAGE DOOR JAMB (S).

RECOMMENDATION: CUT OFF THE BASE OF THESE JAMBS AND PACK THE RESULTING VOID WITH A GOOD MORTAR FILLER.

***** This is a Section 1 Item *****

Item 8B: FINDING: WOOD DECAY FUNGI DAMAGE WAS FOUND IN THE SIDE DOOR OF THE GARAGE.

RECOMMENDATION: REMOVE AND REPLACE THE DAMAGED DOOR WITH A NEW DOOR THAT MATCHES EXISTING AS CLOSE AS POSSIBLE.

***** This is a Section 1 Item *****

7025	TAMOSIIANTER WAY	SACRAMENTO		
BLDG. NO.	STREET	CITY		
	01/10/2001	994806		
STAMP NO.	DATE OF INSPECTION	CO. REPORT NO.		

GARAGE:

Item 8C: FINDING: PORTIONS OF THE GARAGE WERE INACCESSIBLE DUE TO HEAVY STORAGE. THE AREAS THAT WERE INSPECTED DID NOT REVEAL ANY ACTIVE INFESTATIONS OR INFECTIONS IN VISIBLE/ACCESSIBLE AREAS.

RECOMMENDATION: NO FURTHER RECOMMENDATION IS MADE. ******** Information Item ********

Item 8D: FINDING: AN ACTIVE ROOF LEAK WAS NOTED IN THE GARAGE.

RECOMMENDATION: OWNER TO CONTACT ROOFER FOR REPAIRS.

***** This is a Section 1 Item *****

Item 8E: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE COVER OF THE HOT WATER CLOSET. ***

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

***** This is a Section 1 Item *****

DECKS - PATIOS:

Item 9A: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE 4X6 POST.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

Item 9B: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE 2X4 RAFTER TAILS.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

OTHER - INTERIORS:

Finding 10A:

FINDING: THE SHEETROCK IS STAINED IN THE HOT WATER CLOSET DUE TO ROOF LEAK.

RECOMMENDATION: OWNER TO CONTACT ROOFER FOR REPAIRS TO ROOF. THE SHEETROCK SHOULD DRY OUT.

Item 10B: FINDING: THE GROUT IS DEFICIENT AT THE KITCHEN COUNTER.

RECOMMENDATION: APPLY GROUT AS NEEDED TO FORM A WATER RESISTANT SEAL.

***** This is a Section 2 Item *****

Finding 10C:

FINDING: THE INTERIOR SHEETROCK IS CRACKED THROUGHT THE RESIDENCE.

THIS ITEM IS FOR INFORMATION ONLY.

Finding 10D:

FINDING: THE LINO IS PEELING UP ADJ TO THE SLIDING GLASS DOOR.

THIS ITEM IS FOR INFORMATION ONLY.

OTHER EXTERIORS:

Item 11A: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE 2X4 RAFTER TAIL.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

Item 11B: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE 1X4 FACIA.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

7025	TAMOSHANTER WAY	SACRAMENTO
BLDG, NO.	STREET	CITY
	01/10/2001	994806
STAMP NO.	DATE OF INSPECTION	CO. REPORT NO.

OTHER - EXTERIORS:

Item 11C: FINDING: WOOD DECAY FUNGI DAMAGE WAS NOTED IN THE ROOF FRAMING, EVES, SIDING, AND HEADER AROUND THE SKYLIGHT.

RECOMMENDATION: REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD.

****** This is a Section 1 Item ******

Item 11D: FINDING: WOOD DECAY FUNGI DAMAGE WAS FOUND IN THE EAVES OF THE STRUCTURE AS DESIGNATED -11D- ON THE DIAGRAM.

RECOMMENDATION: REMOVE AND REPLACE THE DAMAGED WOOD MEMBERS WITH NEW WOOD. APPY DISODIUM OCTABORATE TETRAHYDRATE (TIM-BOR) TO THE AREAS OF REPAIR TO INHIBIT THE FURTHER GROWIH OF WOOD DECAY FUNGI. NOTE: DURING THE COURSE OF THIS REPAIR, THE ROOF COVERING WILL BE DISTURBED. IT IS THE RESPONSIBILITY OF THE QUARR OF THE STRUCTURE TO CONTACT A LICENSED ROOFING CONTRACTOR TO MAKE ANY REPAIRS TO THE ROOF COVERING SYSTEM.

***** This is a Section 1 Item *****

CAUTION PESTICIDES ARE CHEMICALS

SECTION 8538.(a) OF THE STRUCTURAL PEST CONTROL ACT REQUIRES THAT THE FOLLOWING INFORMATION BE GIVEN WITH ALL REPORTS THAT WILL REQUIRE SOME FORM OF CHEMICAL TREATMENT.

STRUCTURAL PEST CONTROL OPERATORS ARE LICENSED AND REGULATED BY THE STRUCTURAL PEST CONTROL BOARD, AND APPLY PESTICIDES WHICH ARE REGISTERED AND APPROVED FOR USE BY THE CALIFORNIA DEPARTMENT OF FOOD AND AGRICULTURE AND THE UNITED STATES ENVIRONMENTAL PROTECTION AGENCY. REGISTRATION IS GRANTED WHEN THE STATE FINDS THAT BASED ON EXISTING SCIENTIFIC EVIDENCE THERE ARE NO APPRECIABLE RISKS IF PROPER USE CONDITIONS ARE FOLLOWED OR THAT THE RISKS ARE OUTWEIGHED BY THE BENEFITS. THE DEGREE OR RISK DEPENDS UPON THE DEGREE OF EXPOSURE, SO EXPOSURE SHOULD BE MINIMIZED.

IF WITHIN 24 HOURS FOLLOWING APPLICATION YOU EXPERIENCE SYMPTOMS SIMILAR TO COMMON SEASONAL ILLNESS COMPARABLE TO THE FLU, CONTACT YOUR PHYSICIAN OR POISON CONTROL CENTER AND YOUR PEST CONTROL OPERATOR IMMEDIATELY.

FOR FURTHER INFORMATION CONTACT ANY OR THE FOLLOWING:
MITCHELL HALL TERMITE CONTROL - (916) 782-2303
COUNTY HEALTH DEPT. - (916) 875-5881
CO. AGRICULTURE COMMISSIONER - (916) 875-6603
STRUCTURAL PEST CONT. BOARD - (916) 263-2533
POISON CONTROL CENTER - (800) 876-4766

PESTICIDES ACTIVE INGREDIENTS TARGET PEST
TIMBOR DISODIUM OCTABORATE TETRAHYDRATE WOOD DECAY FUNGI

PREMISE IMIDACLOPRID SUBTERRANEAN TERMITES

METHYL BROMIDE SAME WOOD BORING BEETLES

VIKANE SULFURYL FLOURIDE WOOD BORING BEETLES/
DRYWOOD TERMITES

7025	TAMOSHANTER WAY	SACRAMENTO	·
BLDG, NO.	STREET	CITY	
	01/10/2001	994806	
STAMP NO.	DATE OF INSPECTION	CO. REPORT NO.	

REINSPECTION OF WORK PERFORMED BY THE OWNER OR OTHERS TO OBTAIN A CERTIFICATION IS REQUIRED BY LAW. THERE IS A CHARGE FOR EACH INSPECTION AND THE AMOUNT WILL NOT EXCEED THE FEE ORIGINALLY CHARGED. THOSE PERFORMING REPAIRS ARE ADVISED TO CONTACT MITCHELL HALL TERMITE CONTROL AS MORE THAN ONE REINSPECTION MAY BE NECESSARY. THE REQUEST FOR REINSPECTION MUST MEET THE FOLLOWING CRITERIA: 1) IT MUST BE MADE WITHIN FOUR MONTHS OF THE DATE OF THE ORIGINAL REPORT; 2) THE PARTIES INVOLVED MUST BE AWARE THAT A REINSPECTION IS MADE TO DETERMINE IF THE ORIGINAL CONDITIONS WERE CORRECTED. WE DO NOT GUARANTEE REPAIRS PERFORMED BY OTHERS. IF A GUARANTEE IS DESIRED, THE PERSON PERFORMING THE REPAIRS SHOULD BE CONTACTED.

MITCHELL HALL TERMITE CONTROL APPRECIATES THE OPPORTUNITY TO INSPECT YOUR HOME. IF YOU HAVE ANY QUESTIONS REGARDING THIS REPORT, PLEASE CONTACT OUR OFFICE AT (916) 965-5858.



WORK AUTHORIZATION CONTRACT

Address of Property: Inspection Date:

7025 TAMOSHANTER WAY SACRAMENTO, Ca. 95822

Termite Report #:

01/10/2001 994806

State Stamp #:

Title Co. & Escrow #:

SECTION 1		SECTI	ON	2	UNKNOWN	FURTHER	INSP.			
•	112288888899111111	<u> </u>	26377250 55555005 3 11 7277552	1C: 2C: 5A: 10B:	<i>፡</i>	75.00 100.00 25.00 50.00				

We Authorize the Following Section 1 Items to be Performed.

We Authorize the Following Section 2 Itanus to be Performed.

1C, 2C, 5A, 10B

We Authorize the Following Items for Unknown Further Inspection.

1B, 2A, 2B, 8A, 8B, 8D, 8E, 9A, 9B,

Proposed Cost Section 1: Proposed Cost Section 2: Proposed Cost Unknown F.I.: Inspection Fee:

CUSTOMER INFORMATION

The total amount of this contract is due and payable upon completion of the work listed above unless otherwise specified. Only the work specified in the contract is being done at this time due to owners wishes. ANY WORK PERFORMED AGAINST AN EXISTING TITLE ESCROW WILL BE THE FINANCIAL RESPONSIBILITY OF THE OWNER/SELLER OR AGENT ACTING ON BEHALF OF THEREOF IN THE EVENT OF A CANCELLED TITLE ESCROW.

Work completed (LABOR) by operator shall be guaranteed for a period of one year from completion. Toilet plumbing(parts supplied by this firm), showers, floors or any measures for the control of moisture are guaranteed for (30) days only. Chemical treats are guaranteed for one year. Only the areas treated are guaranteed.

Customer agrees to hold company harmless for any damage which may occur to plant life, wiring, trees, vines, pets, tile roofs, plumbing leaks, or changes beyond control of the company which may occur during the performance of this work. In case of non-payment by owner, reasonable attorney's fees and costs of collection shall be paid by the owner, whether suit be filed or not. A SERVICE CHARGE OF 1-1/2 PERCENT, PER MONTH WILL BE CHARGED ON ALL BALANCES OVER (30) DAYS. THE 1-1/2 PERCENT PER MONTH, EQUALS 18 PERCENT PER ANNUM ON THE UNPAID BALANCES.

Any additional damage found while work is being performed will be supplemented by a report as to additional findings and costs.

All repairs performed by others must be re-inspected by OUR COMPANY before a CERTIFICATION will be issued. We do not guarantee work completed by others. Any repairs completed by others must be guaranteed in writing and submitted to OUR COMPANY before a CERTIFICATION will be issued. This firm does not make statements concerning workmanship. Workmanship is only determinable by those paying for or receiving those services.

If at the time of repairs to dacks the damage is found to be more extensive, a Supplamental report will be given along with a bid for any other corrections that may be necessary.

A re-inspection of specific Items on the report or of any other conditions pertaining to this structure can be done at an ADDITIONAL COST PER TRIP. The re-inspection must be done within (4) months of the original inspection.

Our inspectors are not equipped with 40 ft. ladders therefore all two story buildings will not be inspected at the caves unless requested.

NOTICE TO PROPERTY OWNERS: (Section 7018 of the California Contractors License Law, Business & Professonal Code Div. 3, Chap. 9)
Provides under the Mechanic's Lien Law any contractor, subcontractor, laborer, supplier or other person who helps to improve your
property but is not paid for his work or supplies has a right to enforce a claim against your property. This means that, after
a court hearing, your property could be sold by the court officer and the proceeds of the sale used to satisfy the indebtedness.
This can happen even if you have paid your own contractor in full, if the subcontractor, laborer, or supplier remains unpaid.

I Have Read This Contract And The Termite Report It Refers To.

SIGNED WORK AUTHORIZATION CONTRACT MUST BE RECEIVED BEFORE WORK WILL BE SCHEDULED.

I have read and understand the terms of this work authorization contract and hereby agree to all terms thereof,

APPROVED AND READ BY: DATE ACCEPTED FOR: DATE MITCHELL HALL TERMITE CONTROL