

CITY OF SACRAMENTO

1231 I Street, Sacramento, CA 95814

Permit No: 0110326

Insp Area: 1

Thos Bros: 297F3

Site Address: 305 21ST ST SAC

Parcel No: 003-0082-003

Sub-Type: RES

Housing (Y/N): N

CONTRACTOR

OWNER

ANDERSON JERRI R
305 21ST ST
SACRAMENTO CA 95814

ARCHITECT

Nature of Work: DRY ROT REPAIR - REPLACE SIDING AND 2 OR 3 FLOORE JOISTS.
SEE PESTS REPORT

CONSTRUCTION LENDING AGENCY : I hereby affirm under penalty of perjury that there is a construction lending agency for the performance of the work for which this permit is issued (Sec. 3097, Civ. C).

Lender's Name Lender's Address

LICENSED CONTRACTORS DECLARATION: I hereby affirm under penalty of perjury that I am licensed under provisions of Chapter 9 (commencing with section 7000) of Division 3 of the Business and Professions Code and my license is in full force and effect.

License Class License Number Date Contractor Signature

OWNER-BUILDER DECLARATION: I hereby affirm under penalty of perjury that I am exempt from the contractors License Law for the following reason (Sec. 7031.5, Business and Professions Code; any city or county which requires a permit to construct, alter, improve, demolish, or repair any structure, prior to its issuance, also requires the applicant for such permit to file a signed statement that he or she is licensed pursuant to the provisions of the Contractors License Law (Chapter 9 (commencing with Section 7000) of Division 8 of the Business and Professions Code) or that he or she is exempt therefrom and the basis for the alleged exemption. Any violation of Section 7031.5 by any applicant for a permit subjects the applicant to a civil penalty of not more than five hundred dollars (\$500.00);

I, as a owner of the property, or my employees with wages as their sole compensation, will do the work, and the structure is not intended or offered for sale (Sec. 7044, Business and Professional Code: The Contractors License Law does not apply to an owner of property who builds or improves thereon, and who does such work himself or herself or through his/her own employees, provided that such improvements are not intended or offered for sale. If, however, the building or improvement is sold within one year of completion, the owner-builder will have the burden of proving that he/she did not build or improve for the purpose of sale.)

As owner of the property, am exclusively contracting with licensed contractors to construct the project (Sec. 7044, Business and Professions Code: The Contractors License Law does not apply to an owner of property who builds or improves thereon, and who contracts for such projects with a contractor(s) licensed pursuant to the Contractors License Law).

I am exempt under Sec. B & PC for this reason:

Date 8/14/01 Owner Signature Jerri R. Anderson

IN ISSUING THIS BUILDING PERMIT, the applicant represents, and the city relies on the representation of the applicant, that the applicant verified all measurements and locations shown on the application or accompanying drawings and that the improvement to be constructed does not violate any law or private agreement relating to permissible or prohibited locations for such improvements. This building permit does not authorize any illegal location of any improvement or the violation of any private agreement relating to location of improvements.

I certify that I have read this application and state that all information is correct. I agree to comply with all city and county ordinances and state laws relating to building construction and herby authorize representative(s) of this city to enter upon the abovementioned property for inspection purposes.

Date 8-14-01 Applicant/Agent Signature Jerri R. Anderson

WORKER'S COMPENSATION DECLARATION: I hereby affirm under penalty of perjury one of the following declarations:

I have and will maintain a certificate of consent to self-insure for workers' compensation as provided for by Section 3700 of the Labor Code, for the performance of work for which the permit is issued.

I have and will maintain workers' compensation insurance, as required by Section 3700 of the Labor Code, for the performance of the work for which this permit is issued. My workers' compensation insurance carrier and policy number are:

Carrier Policy Number Exp Date

This section need not be completed if the permit is for \$100 or less. I certify that in the performance of the work for which this permit is issued, I shall not employ any person in any manner so as to be subject to the workers' compensation laws of California and agree that if I should become subject to the workers' compensation provisions of Section 3700 of the Labor Code, I shall forthwith comply with those provisions.

Date 8-14-01 Applicant Signature Jerri R. Anderson

WARNING: FAILURE TO SECURE WORKER'S COMPENSATION COVERAGE IS UNLAWFUL AND SHALL SUBJECT AN EMPLOYER TO CRIMINAL PENALTIES AND CIVIL FINES UP TO ONE HUNDRED THOUSAND DOLLARS (\$100,000) IN ADDITION TO THE COST OF COMPENSATION, DAMAGES AS PROVIDED FOR IN SECTION 3706 OF THE LABOR CODE, INTEREST AND ATTORNEY'S FEE.

THIS PERMIT SHALL EXPIRE BY LIMITATION IF WORK IS NOT COMMENCED WITHIN 180 DAYS.

OWNER-BUILDER VERIFICATION

ATTENTION PROPERTY OWNERS

An owner-builder building permit has been applied for in your name and bearing your signature.

Please complete and return this information in the envelope provided at your earliest opportunity to avoid unnecessary delay in processing and issuing your building permit. No building permit will be issued until this verification is received.

1. I personally plan to provide the major labor and materials for construction of the proposed Improvement (yes or no) NO
2. I (have/have not) HAVE signed an application for A building permit for the proposed work.

3. I have contracted with the following person (firm) to provide the proposed construction:

Name J Address \_\_\_\_\_

City \_\_\_\_\_ Telephone B

Contractors License No. [Signature]

4. I plan to provide portions of the work, but I have hired the following person to coordinate, Supervise, and provide the major work.

Name \_\_\_\_\_ Address \_\_\_\_\_

City \_\_\_\_\_ Telephone \_\_\_\_\_

Contractors License No. \_\_\_\_\_

5. I will provide some of the work but I have contracted (hired) the following to provide the Work indicated:

Name	Address	Phone	Type of work

Signed Terri R. Anderson

Job Address 305 21<sup>st</sup> ST


Permit No: 0110326

# WOOD DESTROYING PESTS AND ORGANISMS REPORT

114 COPY

This is an inspection report only - not a Notice of Completion  
ADDRESS OF PROPERTY INSPECTED

BUILDING NO. 305	STREET 21st Street	CITY Sacramento	ZIP 95814	COUNTY CODE 34	DATE OF INSPECTION 08/24/2000	# OF PAGES 7
---------------------	-----------------------	--------------------	--------------	-------------------	----------------------------------	-----------------

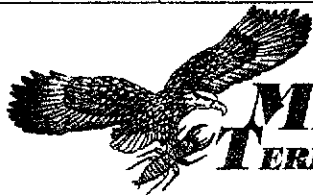

1 800 273-0988  
PHONE (916) 362-4400  
FAX (916) 362-4429

A LICENSED PEST CONTROL OPERATOR  
IS AN EXPERT IN HIS/HER FIELD. ANY  
QUESTIONS RELATED TO THIS REPORT  
SHOULD BE REFERRED TO HIM/HER.

9900 HORN ROAD SUITE 5 SACRAMENTO, CA 95827

REGISTRATION # PR 3416	REPORT # TR-75618	STAMP # I00002275	ESCROW #
---------------------------	----------------------	----------------------	----------

OWNER: Anderson, Jerri P.O. Box 385 Walnut Grove CA 95690


REALTOR: \_\_\_\_\_

TITLE: \_\_\_\_\_

PARTY IN INTEREST: Sam Holsinger Affordable Appraisal 2712 Leoleta Way Carmichael 95608

ORIGINAL REPORT	LIMITED REPORT	SUPPLEMENTAL REPORT	REINSPECTION REPORT	*ORIGINAL STAMP #	DATE
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
<p>GENERAL DESCRIPTION: This property consists of a one story furnished and occupied single family residence with wood exterior.</p> <p>TAG POSTED: Subarea</p> <p>OTHER TAGS:</p>					
1. SUBSTRUCTURE AREA	Dry Portions Inaccessible See 1 Below			X	X
2. STALL SHOWER	Water Tested No Leaks				
3. FOUNDATIONS	Concrete Above Grade				
4. PORCHES -STEPS	Wood See 4 Below				X
5. VENTILATION	Appears Adequate Above Grade				
6. ABUTMENTS	None				
7. ATTIC SPACES	Limited Due To Insulation				
8. GARAGES	None				
9. DECKS - PATIOS	Wood Deck See 9 Below			X	X
10. OTHER - INTERIOR	Inspected Accessible				
11. OTHER - EXTERIOR	Inspected Accessible See 11 Below			X	X

**DIAGRAM AND EXPLANATION OF FINDINGS (This report is limited to structure shown on diagram) Diagram not to scale**

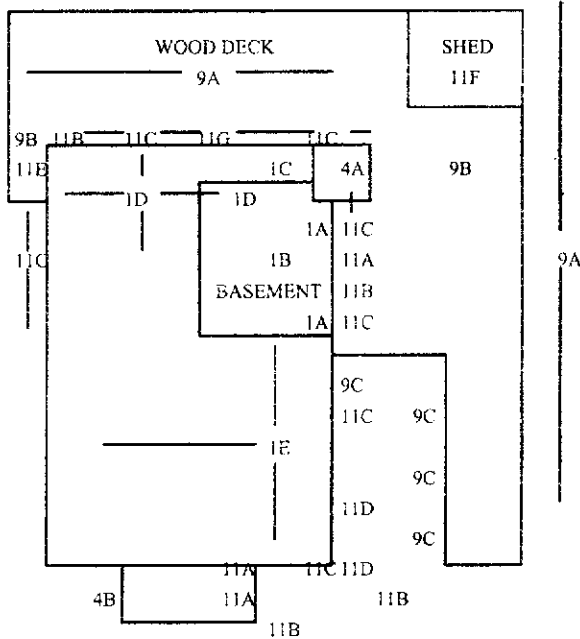

ME

Inspected by Dudgeon Michael, Stephen License Number FR 30371 Signature Mike Dudgeon

You are entitled to obtain copies of all reports and completion notices on this property filed with the Board during the preceding two years upon payment of a \$2.00 search fee to  
Structural Pest Control Board, 1418 Howe Avenue, Suite 18, Sacramento, CA 95825-3280

If satisfaction is not obtained you may contact the Structural Pest Control Board at: Southern California - (213) 897-7838 Bay Area - (415) 557-9114 Sacramento - (916)263-2533

# SECOND PAGE OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

ADDRESS OF  
PROPERTY  
INSPECTED

**305**  
BUILDING NUMBER

**21st Street**  
STREET

**Sacramento**  
CITY

**95814**  
ZIP

INSPECTED

**I00002275**  
STAMP NUMBER

**08/24/2000**  
DATE OF INSPECTION

**TR-75618**  
REPORT NUMBER

Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These include but not limited to: Inaccessible and/or, insulated attics or portions thereof, attics with less than 18" clear crawl space, the interior of hollow walls; spaces between floor or porch deck and the ceiling below; areas where there is no access without defacing or tearing out lumber, masonry or finished work; areas behind stoves, refrigerators or beneath floor coverings, furnishings; areas where encumbrances and storage, conditions or locks make inspection impractical; and areas or timbers around eaves that would require use of an extension ladder.

Slab floor construction has become more prevalent in recent years. Floor coverings may conceal cracks in the slab that will allow infestations to enter. Infestation may be concealed by plaster, sheetrock or other wall coverings so that a diligent inspection may not uncover the true condition. The roof was not inspected due to lack of accessibility, qualification and licensing. These areas are not practical to inspect because of health hazards, possible damage, obstruction or inconvenience and unless specified or described in this WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT. This company shall exercise due care during inspections and treatments but assume no liability for any damage to tiles, slates, shingles or other roofing materials, including patio covers, aluminum awnings, solar heating, plants, shrubbery or paint during any type of treatment. Re: Business and Professions Code, Division 3, Chapter 14, Article 1 and Title 16, Division 19, Article 5.

The purpose of this report is to document findings and recommendations which pertain to the absence or presence of wood destroying pests and organisms and or conducive condition(s) AT THE TIME OF INSPECTION. This report should be read carefully and is not to be confused with a home structural survey. The client's cooperation and compliance to correct and or complete the recommendations documented in this report are obligatory. Without a mutual effort this company can not assure effective or satisfactory results.

Notice: The exterior surface of the roof was not inspected. If you want the water tightness of the roof to be determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

Notice: This company is licensed by The Structural Pest Control Board to perform wood destroying organism inspections; and identifications as well as perform the control measures required by state law to eradicate infestations, infection or adverse condition. No other tradesman has these credentials, or the experience of a pest control operator. Any assertion about the absence or presence of a wood destroying organisms, or conditions deemed likely to lead to an infestation or infection made by a tradesman other than a licensed pest control operator is a violation of Structural Pest Control Act, Business and Professions code, Division 3, Articles 1-10.

A SEPARATED REPORT has been requested. If is defined as SECTION 1, SECTION 2, or UNKNOWN conditions evident on the date of the inspection.

- SECTION 1 FINDINGS: This section contains items where there is evidence of active infestations or conditions that have resulted in/or from infestations or infections.
- SECTION 2 FINDINGS: This section contains items or conditions deemed likely to lead to infestations or infections, but where no visible evidence of infestations or infections were found at this time.
- UNKNOWN FINDINGS: These are areas which are inaccessible for inspection and therefore cannot be labeled as SECTION 1, or SECTION 2 FINDINGS at this time until further inspection is made.

ATTENTION: To obtain a certification clearance for active infections or infestations, only SECTION 1 and/or UNKNOWN FINDINGS must be completed.

## SUBSTRUCTURE:

### SECTION 1 FINDING

- 1A Fungus (dry rot) damage was noted to the 2x4 wall studs and mud sill on the right side of the structure. See 1A on diagram.

RECOMMENDATION: Remove and replace damaged wood members with new material and treat adjacent or exposed wood members with an approved chemical fungicide (COPPER NAPHTHENATE) to correct the above noted condition. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

### SECTION 2 FINDING

- 1B Plumbing leak was noted beneath the kitchen sink. See 1B on diagram.

RECOMMENDATION: Make necessary repairs to correct the above reported leak. ATTENTION: Treat adjacent wood members with an approved fungicide.

# THIRD PAGE OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

ADDRESS OF  
PROPERTY  
INSPECTED

305  
BUILDING NUMBER

21st Street  
STREET

Sacramento  
CITY

95814  
ZIP

INSPECTED

I00002275  
STAMP NUMBER

08/24/2000  
DATE OF INSPECTION

TR-75618  
REPORT NUMBER

## SUBSTRUCTURE CONTINUED:

### SECTION 1 FINDING

1C Fungus (dry rot) damage was noted to the 1x4 subfloor and 4x6 joist beneath the rear porch. See 1C on diagram.

RECOMMENDATION: From the subarea, remove and replace visibly damaged wood members with new material and re-support as needed. Treat adjacent wood members with an approved chemical fungicide (COPPER NAPHTHENATE). ATTENTION: If damage cannot be fully removed from the subarea or extends into areas not accessible, a Supplemental Report will be issued on findings and owner or their representative will be contacted with additional costs.

### SECTION 1 FINDING

1D Fungus growth noted to the subfloor beneath the laundry room. See 1D on diagram.

RECOMMENDATION: Remove all visible surface fungus growth and apply an approved chemical fungicide (COPPER NAPHTHENATE) to infected area(s).

### UNKNOWN FINDING

1E Portions of the subarea are inaccessible due to no access opening. See 1E on diagram.

RECOMMENDATION: Install adequate sized permanent opening to gain access into area and issue a Supplemental Report on findings.

## PORCHES-STEPS:

### SECTION 1 FINDING

4A Fungus (dry rot) damage was noted to the 2x12 stair jack and 2x6 steps at the rear wood porch. See 4A on diagram.

RECOMMENDATION: Remove and replace damaged stair jacks and/or steps with new material to correct the above noted condition. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

### SECTION 2 FINDING

4B Earth-to-wood contact noted to the lattice on the left side of the front porch. See 4B on diagram.

RECOMMENDATION: Lower soil away from wood members to correct earth-to-wood contact. ATTENTION: During the performance of repairs at the above mentioned areas, once the soil is lowered, if any additional damage or infestation is noted to wood members that was not visible or accessible at the time of inspection. A Supplemental Report will be issued on findings and owner or their representative will be contacted with additional cost.

## DECKS - PATIOS:

### UNKNOWN FINDING

9A Portions of the rear attached wood deck were noted to be inaccessible for inspection due to lack of clearance between the soil and wood members. See 9A on diagram.

RECOMMENDATION: Remove portions of decking to allow for inspection for wood members under deck and issue a Supplemental Report on findings. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

# FOURTH PAGE OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

ADDRESS OF  
PROPERTY  
INSPECTED

305  
BUILDING NUMBER

21st Street  
STREET

Sacramento  
CITY

95814  
ZIP

INSPECTED

100002275  
STAMP NUMBER

08/24/2000  
DATE OF INSPECTION

TR-75618  
REPORT NUMBER

## DECKS - PATIOS CONTINUED:

### SECTION 1 FINDING

9B Fungus (dry rot) damage was noted to approximately 40 lineal feet of 2x6 deck boards. See 9B on diagram.

RECOMMENDATION: Remove and replace damaged wood decking with new material. ATTENTION: If damage exceeds specified footage or any additional damage is found a Supplemental Report will be issued on findings and owner or their representative will be contacted with additional costs. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

### SECTION 1 FINDING

9C Fungus (dry rot) damage was noted to approximately four 4x4 support posts and pads at the wood deck. See 9C on diagram.

RECOMMENDATION: Remove and replace damaged wood members with new material and treat adjacent or exposed wood members with an approved chemical fungicide (COPPER NAPHTHENATE) to correct the above noted condition. ATTENTION: Application of caulking or sealant is considered a normal homeowner repair and MILLENNIUM TERMITE will not guarantee against future leaks of this type.

## OTHER EXTERIOR:

### SECTION 1 FINDING

11A Fungus (dry rot) damage was noted to the 1x4 soffits at the front porch and right side of the structure. See 11A on diagram.

RECOMMENDATION: Remove the damaged 1x4 enclosed soffit(s). Inspect wood members for additional damage and treat with an approved chemical fungicide (DISODIUM, OCTABORATE and TETRAHYDRATE SOLUTION). Reinstall new soffit(s) to match as close as possible. ATTENTION: If additional damage is found, a Supplemental Report will be issued on findings and owner or their representative will be contacted with additional costs. ATTENTION: Application of caulking or sealant is considered a normal homeowner repair and MILLENNIUM TERMITE will not guarantee against future leaks of this type.

### SECTION 1 FINDING

11B Fungus (dry rot) damage was noted to the 1x6 fascia at the front, rear, and right side of the structure. See 11B on diagram.

RECOMMENDATION: Remove and replace damaged wood members with new material and treat adjacent or exposed wood members with an approved chemical fungicide (COPPER NAPHTHENATE) to correct the above noted condition. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

### SECTION 1 FINDING

11C Fungus (dry rot) damage was noted to approximately 140 lineal feet of 1x5 lap siding. See 11C on diagram.

RECOMMENDATION: Remove and replace approximately 140 lineal feet of damaged siding with new to match existing as close as possible. ATTENTION: If additional damage is found a Supplemental Report will be issued on findings and owner or their representative will be contacted with additional costs. ATTENTION: MILLENNIUM TERMITE is not responsible for any texture or painting that may be necessary.

# FIFTH PAGE OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

ADDRESS OF  
PROPERTY  
INSPECTED

305

BUILDING NUMBER

21st Street

STREET

Sacramento

CITY

95814

ZIP

INSPECTED

100002275

STAMP NUMBER

08/24/2000

DATE OF INSPECTION

TR-75618

REPORT NUMBER

## OTHER EXTERIOR CONTINUED:

### SECTION I FINDING

11D Fungus (dry rot) damage was noted to the 1x3 corner trim at the front of the structure. See 11D on diagram.

RECOMMENDATION: Remove and replace damaged wood members with new material and treat adjacent or exposed wood members with an approved chemical fungicide (COPPER NAPHTHENATE) to correct the above noted condition. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

### SECTION I FINDING

11E Fungus (dry rot) damage was noted to the 1x3 left side window trim. See 11E on diagram.

RECOMMENDATION: Remove and replace damaged wood members with new material and treat adjacent or exposed wood members with an approved chemical fungicide (COPPER NAPHTHENATE) to correct the above noted condition. ATTENTION: During the performance of repairs at the above mentioned areas, should any additional damage or conditions be found that were not visible or accessible at the time of the inspection without removing lumber or finished products, the owner or their representative will be contacted for direction.

### SECTION I FINDING

11F Portions of detached wood shed were noted to be inaccessible for inspection due to storage. See 11F on diagram.

RECOMMENDATION: Remove storage away from wall to allow for further inspection.

## NOTED ITEMS:

Inspection of the upper area trim and siding is limited due to height. The visible portions were inspected and no signs of infections or infestations were noted at this time. ATTENTION: MILLENNIUM TERMITE cannot be held responsible for any current or future infestations that are not visible at this time.

The rear door and wood screen door noted slightly deteriorated. No infections or infestations were noted at the time of the inspection; therefore, no recommendations are made at this time.

Water stains noted to the rear porch cover. No leakage was noted at time of inspection; therefore, no recommendations are made. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any leakage not noted at time of inspection.

The window sills noted slightly deteriorated. No evidence of fungus or leakage was noted at the time of inspection; therefore, no recommendations are made at this time as this is considered a normal homeowner maintenance item.

The kitchen sink noted slightly deteriorated. No evidence of fungus or leakage was noted at the time of inspection; therefore, no recommendations are made at this time as this is considered a normal homeowner maintenance item.

Water stains noted beneath the laundry, kitchen and bath. No leakage was noted at time of inspection; therefore, no recommendations are made. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any leakage not noted at time of inspection.

Water stains noted beneath the kitchen sink. No leakage was noted at time of inspection; therefore, no recommendations are made. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any leakage not noted at time of inspection.

The floor area of the bathroom was noted carpeted. No infections or infestations were noted on the visible portions of the floor; therefore, no recommendations are made at this time. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any damage that may be concealed under carpet.

Mold growth was noted to the stall shower walls. No infections or infestations were noted at the time of the inspection; therefore, no recommendations are made as this condition is part of normal homeowner maintenance.

# SIXTH PAGE OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

ADDRESS OF  
PROPERTY  
INSPECTED

305

21st Street

Sacramento

95814

BUILDING NUMBER

STREET

CITY

ZIP

INSPECTED

100002275

08/24/2000

TR-75618

STAMP NUMBER

DATE OF INSPECTION

REPORT NUMBER

## NOTED ITEMS CONTINUED:

The stall shower noted slightly deteriorated. No evidence of fungus or leakage was noted at the time of inspection; therefore, no recommendations are made at this time as this is considered a normal homeowner maintenance item.

The composition roof covering is not inspected and not included in this report. If interested parties desire an inspection and/or guarantee on the roof covering, MILLENNIUM TERMITE recommends they contact a licensed roofing contractor for further inspection and to make any needed repairs to obtain guarantee.

Slight deterioration was noted to roof covering. No inspection was made of the roof covering and the roof covering is not included in this report. No visible leakage was noted at time of inspection; therefore, no recommendations are made at this time. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any leakage not noted at time of inspection. If interested parties desire a guarantee on roof covering, MILLENNIUM TERMITE recommends owner call a licensed roofing contractor for further inspection and make any needed repairs to obtain adequate guarantee.

Portions of the roof overhang and/or exterior wood members could only be visually inspected from ground level due to the height. Upon request, if interested parties desire further inspection of these areas, one will be made at an additional charge.

Roof overhangs were noted enclosed with wood soffits preventing inspection of wood members. No visible signs of infections or infestations were noted; therefore, no recommendation is made at this time.

Fences were noted attached to dwelling. Fences are not inspected or included in this report. The contact area of fence to dwelling was inspected and no infection or infestation was noted at this area at the time of the inspection; therefore, no recommendations are made at this time. ATTENTION: Periodic inspection should be made of these areas.

Exterior paint was noted peeling from wood members. No infections or infestations were noted at these areas; therefore, no recommendations are made at this time as painting is considered a normal homeowner maintenance repair.

Wood siding was noted slightly deteriorated by the weather. No evidence of infestation or infection was noted; therefore, no further recommendation is made at this time.

Water stains noted on underside of roof overhang. No leakage was noted at time of inspection; therefore, no further recommendation is made. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any leakage not noted at time of inspection.

Exterior wood sash windows noted weathered. No evidence of infestation or infection was noted; therefore, no further recommendation is made at this time.

Gutters and/or downspout noted rusting and/or deteriorated. No recommendation is made at this time as this is considered a normal homeowner maintenance item.

Slight cracks were noted in ceiling and/or walls at interior of dwelling. No infections, infestations or leaks were noted at these areas at the time of this inspection; therefore, no recommendations are made at this time as these are considered normal homeowner maintenance repairs.

Carpet noted deteriorated at the bathroom. No evidence of leakage, infestation or infection was noted; therefore, no further recommendation is made at this time.

Water stains noted on underside of roof sheathing in attic. No leakage was noted at time of inspection; therefore, no recommendations are made. ATTENTION: MILLENNIUM TERMITE assumes no responsibility for any leakage not noted at time of inspection.



# SEVENTH PAGE OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

ADDRESS OF PROPERTY INSPECTED	305	21st Street	Sacramento	95814
	BUILDING NUMBER	STREET	CITY	ZIP
INSPECTED	10002275	08/24/2000	TR-75618	
	STAMP NUMBER	DATE OF INSPECTION	REPORT NUMBER	

PLEASE SEE ENCLOSED AUTHORIZATION FORM FOR COST TO COMPLETE ABOVE WORK: No painting or decorating included in any estimate.

NOTE: Should any of the above recommendations be completed by parties other than MILLENNIUM TERMITE an inspection is required of the repaired areas before any finished products are installed, at an additional cost.

UPON REQUEST, MILLENNIUM TERMITE will perform a REINSPECTION of the structure, at an additional cost. If an estimate of bid for repairs has been given, repairs must be completed prior to FOUR months after the date of the original inspection. After the FOUR month period a complete new inspection is required by law.

"NOTICE: The Structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However recommendations to correct these findings may vary from company to company. Therefore, you may wish to seek a second opinion since there may be alternative methods of correcting the findings listed on this report that may be less costly."

MILLENNIUM TERMITE assumes no responsibility for work completed by others. If such recommendations are completed by others, MILLENNIUM TERMITE cannot be held responsible for the quality of such work, nor materials used, furthermore, MILLENNIUM TERMITE, does not make any representations to conditions that may or may not be concealed by other's work.

INSPECTION AND REPORT FEE: \$79.00 PAID

BC

"State law requires that you be given the following information: CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Operators are licensed and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and U.S. Environmental Protection Agency. Registration is granted when the state finds that based of existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized."

"If within 24 hours following application, you experience symptoms similar to common season illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately."

Poison Control Center ..... 1-800-342-9293	Your Pest Control Operator ..... 344-4400
Structural Pest Control Board ..... (916) 263-2540	County Ag. Comm. (Application Info.) all 916 area codes
1422 Howe Ave. Sacramento, CA 95825 (Regulatory Info)	Sacramento ..... 875-6603      Placer .... 823-4371
County Health Dept. (Health Questions) Sac ..... (916) 366-2001	El Dorado ..... 530 626-2305      Yolo ..... 656-8140
	Yuba and Sutter Counties ..... 741-7500

TERMITICIDES	ACTIVE INGREDIENTS	FUNGICIDES	ACTIVE INGREDIENTS
DURSBAN TC	CHLORPYRIFOS	COPPER NAPHTHENATE	COPPER SALT OF NAPHTHENATE ACIDS
DEMON TC	CYPERMETHRIN	TIMBOR	BORIC ACID
RECRUIT II	HEXAFLUMURON		
PREMISE	IMIDACLOPRID		